RECEIVED

OCT 3 0 2013

DETFORD TWP. TREASURER

Bedford Township Roads Committee Review October 10, 2013

The Roads Committee reviewed the following roads. This was a cursory review and was intended to be a general overview of roadways in need of improvement. Before final decisions are made as to the recommended improvement additional research including a more thorough review, checking drainage, road width, shoulder width, culverts, etc. will need to be performed. A comprehensive estimate of each improvement has not been performed at this time.

	Road Name	From	То	P/L	Distance	Condition	Type of Improvement Considered
مسر	Sterns Road	Douglas Road	Jackman Road	Р	1.03	Potholes, delamination, high shoulder	Spot patch, pull shoulders (normal maint.)
	Secor Road	Smith Road	Sterns Road	P	0.3+-	Delamination of HMA overlay	Spot patch, pull shoulders (normal maint.)
	Section Road	Whiteford Ctr. Rd.	Secor Road	(L)	0.96	Heavily patched, base failures (25%+)	Options include base repairs, crush & shape w/ overlay or min. of zone patch & seal coat
	Smith Road	Whiteford Ctr. Rd.	Secor Road	P		Failed outer 4-5' pavement, middle fair/poor	Major repair/ reconstruction (FedAid?)
d	Clegg Road	Twp. Line	Monroe Road	(L)	0.61	Heavily patched, base failures (25%)	See comments for Section Road (similar)
	Monroe Road	Summerfield Rd.	Secor Road	P	0.35	Major edge& base failure, drainage	Base and joint repair, possible base crush & shape w/overlay (cold mix option)
1	Dean Road	Monroe Road	Secor Road	(L)	0.25	Edge and base failure, transverse cracks, drainage	Mill & repair edges, transverse joint repair, resurface options
	Dean Road	AARR	Crabb Road	(\hat{L})	.4+-	Major base problems, cold patch	Major repair include reconstruction, base crush and shape with overlay
	Dean Road	Crabb Road	Minx Road	(1)	1.01	Major pav't. failure btw. prev. overlay areas	Crush & shape, stone and overlay in bad areas

	Consear Road	Twp. Line	Summerfield Road	Р	0.38	Good condition, good drainage	Adh - Acron - chys sed (federal propert) No specific work in 2014 - no 1614 h Tupo
	Temperance Road	Summerfield Road	Secord Road	(L)	0.75+-	Drainage problems, high shdrs, edge failures	Possible cold mix overlay w/drainage impr.
	Douglas Road	Temperance Road	Erie Road	(<u>(</u>)	1.01	Isolated pav't failures, fair condition	Zone patch and seal coat
	Crabb Road	Dean Road	Temperance Road	(L)	1.0	Good condition	Crack fill
Į.	Crabb Road	Temperance Road	Erie Road	(L)	1.0	Major base failure, cold patch, outer edges Failed, alligator cracking	Options include reconstruct; base crush & shape, add'l stone and overlay (cold mix)
	Crabb Road	Erie Road	Samaria Road		1.0	Alligator cracking and base failure and Isolated failure areas	Zone patch & seal coat (stop gap); base repairs with cold mix overlay
	Crabb Road	Samaria Road	Rauch Road	(L)	1.0	Narrow, guard rail, narrow drainage structure major base problems	Widen and reconstruct best option but \$\$
	Crabb Road	@ Sterns Road	(Intersection)	P/£)	0.1	Radii problems for trucks	Radii improvements in SE & SW quadrants
	Ivor Lindsay	Ivor Lindsay	Lewis Avenue	(L)		Severe alligator cracking	Mill and resurface, curb repair

of 10/1/13 M/3 or Rendy Reera (Estal for Vhere progress et 8/7/13 out)

- Med processy on - Seen - Summerfield & longues (Where in typy single chys sed)

- South - dougles to Fewer (Where in typy might chy sed)